
Composition of Probe System

OPS-20 series optical probe system include two pieces of hardware and one software package; The software package model is SP-W10, the two pieces of the hardware are:

- 1) OP500 series optical probe (including optional shank and stylus);
- 2) OSI-20 series optical receiver(the standard cable length 8m/the optional lengthened cable).





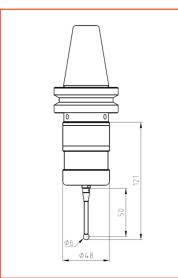

Technical Parameters

- 1) The technical parameters of OP500 series optical probe:
- \bullet Stylus sensing direction: $\pm X$, $\pm Y$, +Z;
- ◆ Stylus sensing over-travel: X-Y±12°, Z+5 mm;
- ◆ The adjusting range of trigger force in Z direction: 500-1000 g;
- ◆ Trigger force in X-Y surface: 50g-100g;
- ♦ Unidirectional repeatability (2σ) : \leq 1 μm;
- ◆ Optical signal receiving/sending distance : 5m;
- ◆ Working days of new batteries (5% utilization rate in a single shift): 140 days;
- ◆ Seal grade: IP68.
- 2) The technical parameters of OSI-10E/OSI-20M optical receiver:
- ◆ Optical signal receiving/sending distance: 5 m;
- ◆ Input voltage: 24V±10%(DC);
- ◆ Output load current: 50 mA;
- ◆ Seal grade: IP68.

Technical Characteristics

- ◆ Probe switch on/off method: Rotate on/off, M code on/off;
- ◆ Infrared coded signals are used to transmit information between the probe and the receiver;
- ◆ Output four kinds of SSR signals to machine control system when probe is in the states of trigger, error, probe batteries low and output pulse;
- ◆ The OSI-20 series receiver can change its logical state of the output signal by setting:
- ◆ Double infrared signal receiving and transmitting devices are used to increase the reliability of the equipment;
- ◆ The LED lights in the receiver show the working status of the probe system.

Applicable equipment

- ◆ Various specifications of machine center, CNC boring-milling machine, drilling machine center and so on.
- ◆ Various specifications of CNC lathes, turning machine center, CNC turning-milling machine center.

PAGE


02

OPS-20 Series Optical Probe System

Subdivision model and function

- 1) OPS-20 probe system
- ◆ OP500 optical probe (Rotate on/off);
- ◆ OSI-10E optical receiver (with13 cores' shielded cable).
- 2) OPS-20M probe system
- ◆ OP500M optical probe (M code on/ off);
- ◆ OSI-20M optical receiver (with13 cores' shielded cable).



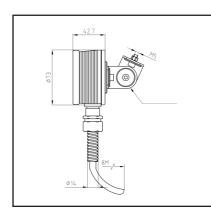

Basic configuration of the probe system

- 1) OP500 Series probe
- ◆ Standard stylus model: M4-P50-RB6-S36A;
- ◆ Battery specification: 14250, 3.6V, 1000mAh; 2 ps.;
- lacktriangle Usually, the probe shank is 7:24 taper shank with the BT or ISO standards , the common models are 30#,40#,50# and etc.; the shank with the HSK or other standards can also be used.
- 2) OSI-10E/OSI-20M receiver
- ◆ The cable length usually is 8 meters;
- ◆ Fixed bracket with universal adjustment function is equipped.

Notes:

- ◆ As for the software package, please consult the our sales staff about whether the CNC system of the machine tool can be equipped with probe; Some CNC systems needs additional settings to use probe;
- ◆ As for the probe's taper shank, verify the standards and specifications of the spindle taper hole for the machine tool before ordering the probe; The taper shank with unusual standard or specification will lead to the probe price increase and the delivery time extend, The tapered shank we provided for the probe does not include the pull stud;
- ◆ As for function of the M code on/off, when purchasing the OPS-20M probe system, you should figure out whether there are two spare M codes in the CNC control system cabinet for the probe to use;
- ◆ As for special stylus, checking whether the standard stylus equipped with the OP500 series probe can meet the requirements and thinking whether it is necessary to order a special stylus;
- ◆ As for the cable length, verify if the 8-meter cable equipped with the OSI-20 receiver is enough for installing it in the machine tool. If it is not, the additional instruction is required when ordering the product.

Application

- ◆ Setting work-piece coordinate system and machining zero points automatically before processing;
- ◆ Detect and control the key dimensions, position coordinates and their precision automatically between two processes;
- ◆ Detect precision of the key dimensions, shapes, position after processing.

Black Probe statu Green SSR Probe status Green Purple SSR Low battery Yellow SSR Low battery Yellow B1ue Error B1ue Error White

Red

0SI-10E

OST-20M		
051 2011	Red	24 VDC
	Black	0 VDC
I	Green	Probe status
SSR	Green	Probe status
	Purple	Pulse
SSR	Purple	Pulse
	Yellow	Low battery
SSR	Yellow	Low battery
	Blue	Error
SSR	Blue	Error
	White	Probe M code
0-	Green/yellow [
	GND (

24 VDC