03

## **OPS-20MS Series Optical Probe System**

## **Composition of Probe System**

OPS-20MS optical probe system include two pieces of hardware and one software package; The software package model is SP-W10, the two pieces of the hardware

- 1) OP500MS optical probe (including optional shank and stylus);
- 2) OSI-20M optical receiver(the standard cable length 8m/the optional lengthened cable).





### **Technical Parameters**

- 1) The technical parameters of OP500MS series optical probe:
- lack Stylus sensing direction:  $\pm X$ ,  $\pm Y$ , +Z;
- ◆ Stylus sensing over-travel: X-Y±12°, Z+5 mm;
- ◆ The trigger force in Z direction: 1000 g;
- ◆ Trigger force in X-Y surface: 100g-160g;
- ♦ Unidirectional repeatability (2σ) :  $\leq$  1μm;
- ◆ Optical signal receiving/sending distance : 5 m;
- ◆ Working days of new batteries (5% utilization rate in a single shift): 140 days;
- ◆ Seal grade: IP68.
- 2) The technical parameters of OSI-20M optical receiver:
- ◆ Optical signal receiving/sending distance: 5 m;
- ◆ Input voltage: 24V±10%(DC);
- ◆ Output load current: 50 mA;
- ◆ Seal grade: IP68.

## **Technical Characteristics**

- ◆ Probe switch on/off method: M code on/off;
- ◆ Infrared coded signals are used to transmit information between the probe and
- $\ensuremath{\blacklozenge}$  Output four kinds of SSR signals to machine control system when probe is in the states of trigger, error, probe batteries low and output pulse;
- ◆ The OSI-20Mreceiver can change its logical state of the output signal by setting;
- ◆ Double infrared signal receiving and transmitting devices are used to increase the
- ◆ The LED lights in the receiver show the working status of the probe system.

## Applicable equipment

- machine center and so on.
- machine center.

◆ Setting work-piece coordinate system and machining zero points automatically before processing;

Application

- ◆ Detect and control the key dimensions, reliability of the equipment; position coordinates and their precision automatically between two processes;
- ◆ Detect precision of the key dimensions, shapes, position after processing.

PAGE

## **OPS-20MS Series Optical Probe System**

# 04

## Basic configuration of the probe system

### 1) OP500MS probe

- ◆ Standard stylus model: M4-P50-RB6-S36A;
- ◆ Extendable main body;
- ◆ Battery specification: 14250, 3.6V, 1000mAh; 2 ps.;
- ◆ Usually, the probe shank is 7:24 taper shank with the BT or ISO standards, the common models are 30#,40#,50# and etc.; the shank with the HSK or other standards can also be used.
- 2) OSI-20M receiver

OSI-20M

SSR

SSR

SSR

Black

Green

Green

Purple

Purple

Yellow

Yellow


White

Green/yellow

B1ue

- ◆ The cable length usually is 8 meters;
- ◆ Fixed bracket with universal adjustment function is equipped.



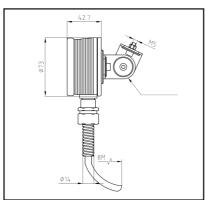

- ◆ As for the software package, please consult the our sales staff about whether the CNC system of the machine tool can be equipped with probe; Some CNC systems needs additional settings to use probe;
- ◆ As for the probe's taper shank, verify the standards and specifications of the spindle taper hole for the machine tool before ordering the probe; The taper shank with unusual standard or specification will lead to the probe price increase and the delivery time extend, The tapered shank we provided for the probe does not include
- ◆ As for function of the M code on/off, when purchasing the OPS-20MS probe system, you should figure out whether there are two spare M codes in the CNC control system cabinet for the probe to use;
- ◆ As for special stylus, checking whether the standard stylus equipped with the OP500 series probe can meet the requirements and thinking whether it is necessary to order a special stylus;
- ◆ As for the cable length, verify if the 8-meter cable equipped with the OSI-20M receiver is enough for installing it in the machine tool. If it is not, the additional instruction is required when ordering the product;

- ◆ Various specifications of machine center, CNC boring-milling machine, drilling
- ◆ Various specifications of CNC lathes, turning machine center, CNC turning-milling

24 VDC

0 VDC

Probe status

Probe status

Pulse

Low battery

Error

Pulse Low battery

Error Probe M code